

### **HEMTT Transmission Filter**

Get a replacement transmission oil filter housing and element for your HEMTTs with NSN 2910-01-167-2932. Make a note for Item 4. Fig 158, in TM 9-2320-279-24P-1 until it's updated to change the part number to 25010975.

### **FMTV Seat Covers**

You can get covers for the bottom and back of FMTV seats without having to order the entire seat. Get a bottom cover with NSN 2540-01-460-8048 and a back cover with NSN 2540-01-463-8394. These numbers are shown in the Jun 98 editions of your -24Ps.

# **HMMWV Blackout Light**

Item numbers for the HMMWV's blackout lamp door and lens retainer are reversed in Fig 55 of TM 9-2320-280-24P-1. To get the lamp door, Item 4, order part number DC8217 (NSN 6220-01-128-0087), which is shown as Item 2. To get the lens retainer, order part number DC8218 (NSN 6220-01-107-2613), which is shown as Item 4.

# M35A3 CTIS NSNs

Fig 117 of TM 9-2320-386-24P gives you wrong info on part numbers for Items 11 and 12, the grommet and the nut for the CTIS valve. Use part number (PN) RG22, NSN 5325-01-437-5810, for Item 11 and PN HN80, NSN 5310-01-445-6872, for Item 12. Make a note until the TM is updated.

#### M2 Breech Locks

Not all M2 machine gun breech locks need to be tested for hardness. New breech locks manufactured by UNI-Star with a CAGE code of 054Q8 and a contract number of SP075099MJ178 meet the hardness requirements called for in TACOM-Rock Island Safety-of-Use message (SOUM) 99-03. All other breech locks should be tested per the SOUM. See your TACOM-Rock Island logistics assistance representative for a copy of the SOUM.

# **MWO Adds Clamp to Mask**

MWO 3-4240-347-20-1 added a retaining clamp to all M40-series masks' outlet valve assemblies. The clamp helps prevent the valve housing from separating. NBC NCOs, if your masks haven't been modified, contact your local MWO coordinator or SBCCOM logistics assistance representative.

# M88A2 Transmission Oil

The transmission in your M88A2 recovery vehicle uses CAT 10 oil, not OE/HDO-10 like the M88A1. The wrong oil could cause the transmission to seize up. A quart of CAT 10 comes with NSN 9150-01-424-7696. 5 gallons with NSN 9150-01-424-7692, and 55 gallons with NSN 9150-01-424-7698. The transmission holds 17 gallons.

### **FMTV Air Pressure Buzzer**

Get the low air pressure buzzer for FMTVs by using NSN 6350-01-455-9287. It buzzes to let you know when there's not enough air pressure to safely operate the vehicle. The NSN was not available when TM 9-2320-365-24P and TM 9-2320-366-24P were printed. Make a note for Item 7 in Fig 50 of both TMs 'til the next update.

DISTRIBUTION: To be distributed in accordance with the initial distribution number (IDN) 340312, requirements for TB 43-PS-Series.

Would You Stake Your Life wight on the Condition of Your Equipment?